

TC11 is direct immersion type MGO packed Thermocouple for Various applications in process temperature measurement. Mgo Packed thermocouples are rigid in construction, can be used in temperature applications in harsh environments.

Key Feature:

- Available in type J, K, E, N, T.
- A wide selection of sheath material to suit application requirement, 304ss, 316ss, 321ss, Inconel® 600, Incolloy 800, Monel, Pyrosil D etc.
- Sheath diameter is available from 0.040" to 0.375".
- Grounded, Ungrounded and Exposed junction to suite application requirement.
- Available with low temp and high temp connectors.
- Available in IEC 60584 & ANSI MC 96.1 standard tolerances

Thermocouple Junction options for TC11



Ungrounded Junction: Junction is similar to grounded junction except wires are fuse welded, which is then insulated with Mgo powder and formed cap by welding without incorporating thermocouple wires. Thus, the junction is called the ungrounded junction.

Key Benefits:

- · Wires are protected from any mechanical damage
- · Offers rugged construction, the same as the grounded junction.
- · Strain due to differential expansion between wire and sheath is minimized with insulated wire



Grounded Junction: In grounded junction thermocouple wires and sheath of the mineral insulated cable is welded together to form a junction. Thermocouple wires and sheath becomes an integral part of the junction. Thus, the wire is grounded to the sheath.

Key Benefits:

- Slower response than Exposed junction, but offers rugged construction.
- Can hold higher pressure than exposed junction and Ungrounded junction.



Exposed Junction: In expose junction, the sheath is removed, and thermocouple wires fuse-welded to form a junction. Tip of the MI cable is sealed with high temperature cement to protect MGO from contamination.


Kev Benefits:

- Fast response time due to the less mass.

Suggested Maximum Temperature Limit As per ASTM E608/608M

Thermocouple Type	°C (F)	°C (F)	°C (F)	°C (F)	°C (F)	°C (F)
OD	1/25"	1/16"	1/8"	3/16"	1/4"	3/8"
Т	260(500)	260(500)	315(600)	370 (700)	370 (700)	370 (700)
J	260 (500)	440(825)	520 (970)	620(1150)	720 (1330)	720 (1330)
K	700(1290)	920 (1690)	1070 (1960)	1150 (2100)	1150 (2100)	1150 (2100)
E	300(570)	510(950)	650 (1200)	730 (1350)	820(1510)	820(1510)

The suggested maximum temperature limit is based on information available in the ASTM standard and test performed in our facility. The maximum temperature limit may change based on the type of process and material/ liquid it is going to be used in. These limits apply to protected thermocouples.

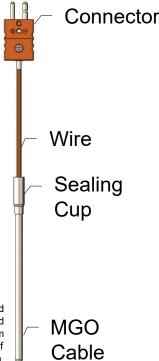

Response Time

	•		
Thermocouple		Junction	
OD	Exposed	Ground ed	Ungrounded
1/25"	0.005	0.1	0.3
1/16"	0.02	0.2	0.5
1/8"	0.03	0.7	1.3
3/16"	0.07	1.1	2.2
1/4"	0.1	2.2	4.5
3/8"	0.0	2.7	7.5

Response time is measured in liquid by inserting thermocouple into the temperature-controlled circulating bath. Time taken to reach 63.2% of a step temperature change is noted as the response time of thermocouple. For a fast response, the exposed tip is recommended, but the exposed junction is not as rugged as ungrounded and grounded junctions for industrial use.

Temperature Accuracy As per ASTM E608/608M/ IEC 60584 & ANSI MC 96.1 standard tolerances


Туре	Temperature	Standard Limit	Special Limit
т	-200 °C to 0 °C	± 1 °C or 1.5% Whichever is greater	N/A
'	0 °C to 350 °C	± 1 °C or .75% Whichever is greater	± 0.5 °C or 0.4% Whichever is greater
J	0 °C to 750 °C	± 2.2 °C or .75% Whichever is greater	± 1.1 °C or 0.4% Whichever is greater
Е	-200 °C to 0 °C	± 1.7 °C or 1.0% Whichever is greater	N/A
_	0 °C to 900 °C	± 1.7 °C or .5% Whichever is greater	± 1 °C or 0.4% Whichever is greater
KORN	-200 °C to 0 °C	± 2.2 °C or 2.0 % Whichever is greater	N/A
KOKN	0 °C to 1250 °C	± 2.2 °C or .75% Whichever is greater	± 1.0 °C or 0.4% Whichever is greater

Notes:

-All the thermocouples are manufactured as ASTM E608/608M -Calibration is available as per ASTM E220 on request





TEMPERATURE SENSOR

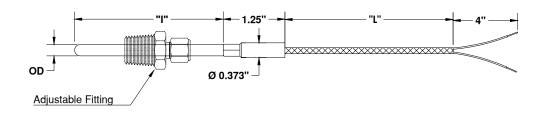

SS Transition "L" WITH ARMOR & TRANSITION

Termination Options-

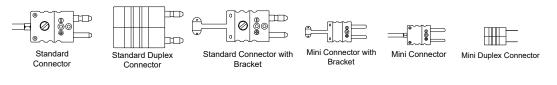

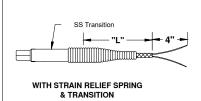

	1	2	3	4	5	6	7	8	9	10	11	12
TC11												

For Example- TC11-K-G-4-8-6i-48i-S8N-2-STP-0-WC

1. THERMOCOUPLE TYPE			
CODE			
J	Iron(+) vs Constantan(-)		
K	Chromel(+) vs Alumel(-)		
T	Copper(+) vs Constantan(-)		
Е	Chromel(+) vs Constantan(-)		
N	Nicrosil(+) vs Nisil(-)		
Use "S" for Special limit of Error			

2. MEASURING JUNCTION				
CODE				
G	Simplex / Grounded Junction			
UG	Simplex / Un- Grounded Junction			
E	Simplex / Exposed			
DG	Duplex / Grounded			
DUG	Duplex / Un-Grounded			
DE	Duplex/ Exposed			

3.SHEATH OD				
CODE	IMPERIAL SIZE	METRIC SIZE		
1	1/ ₁₆ "	1.5 mm		
2	1/8"	3.2 mm		
3	3/16"	4.76 mm		
4	1/4"	6.35 mm		
5	5/16"	7.9mm		
6	3/8"	9.5 mm		
7	0.215"	5.46 mm		
2M	0.079	3.0mm		
3M	0.197"	5.0mm		
4M	0.236"	6.0 mm		
5M	0.315"	8.0mm		
6M	0.354"	9.0 mm		
7M	0.394"	10.0 mm		

4. SHEATH MAT.		
CODE		
8	SS 316	
4	SS 310	

4. SHEATH MAT.		
9	SS 304	
6	SS 321	
3	INCONEL 600	
5	SS 446	
10	INCONEL 800	

5. IMMERSION LENGTH ("I") Immersion length - use "I" for inches and "M" for millimetre

6. LEAD LENGTH ("L") Lead length - use "I" for inches and "M" for millimetre

CODE Not Required 7-1. MATERIAL S S Stainless Steel B B Brass Mild Steel 7-2. SIZE 2 2 ½" 4 ½" 6 ¾" 8 ½" 18 M18 X 1.5 20 M20 X 1.5 7-3. THREAD TYPE N N NPT B BSP Leave blank for metric thread 7-4. FERRULE MATERIAL Leave Blank for SS T T Teffon	7. PROCESS FITTING				
7-1. MATERIAL S Stainless Steel B Brass M Mild Steel 7-2. SIZE 2 ½8" 4 ½4" 6 ¾8" 8 ½2" 18 M18 X 1.5 20 M20 X 1.5 7-3. THREAD TYPE N NPT B BSP Leave blank for metric thread 7-4. FERRULE MATERIAL Leave Blank for SS	CODE				
S Stainless Steel B Brass M Mild Steel 7-2. SIZE 2 ½8" 4 ¼4" 6 ¾8" 8 ½2" 18 M18 X 1.5 20 M20 X 1.5 7-3. THREAD TYPE N NPT B BSP Leave blank for metric thread 7-4. FERRULE MATERIAL Leave Blank for SS	0	Not Required			
B Brass M Mild Steel 7-2. SIZE 2		7-1. MATERIAL			
M Mild Steel 7-2. SIZE 2	S	Stainless Steel			
7-2. SIZE 2	В	Brass			
2	М	Mild Steel			
4		7-2. SIZE			
6 3/8" 8 1/2" 18 M18 X 1.5 20 M20 X 1.5 7-3. THREAD TYPE N NPT B BSP Leave blank for metric thread 7-4. FERRULE MATERIAL Leave Blank for SS	2	½"			
8 ½" 18 M18 X 1.5 20 M20 X 1.5 7-3. THREAD TYPE N NPT B BSP Leave blank for metric thread 7-4. FERRULE MATERIAL Leave Blank for SS	4	<i>Y</i> ₄ "			
18 M18 X 1.5 20 M20 X 1.5 7-3. THREAD TYPE N NPT B BSP Leave blank for metric thread 7-4. FERRULE MATERIAL Leave Blank for SS	6	³ / ₈ "			
20 M20 X 1.5 7-3. THREAD TYPE N NPT B BSP Leave blank for metric thread 7-4. FERRULE MATERIAL Leave Blank for SS	8	<i>Y</i> ₂ "			
7-3. THREAD TYPE N NPT B BSP Leave blank for metric thread 7-4. FERRULE MATERIAL Leave Blank for SS	18	M18 X 1.5			
N NPT B BSP Leave blank for metric thread 7-4. FERRULE MATERIAL Leave Blank for SS	20	M20 X 1.5			
B BSP Leave blank for metric thread 7-4. FERRULE MATERIAL Leave Blank for SS		7-3. THREAD TYPE			
Leave blank for metric thread 7-4. FERRULE MATERIAL Leave Blank for SS	Ν	NPT			
7-4. FERRULE MATERIAL Leave Blank for SS	В	BSP			
Leave Blank for SS	Leave blank for metric thread				
		7-4. FERRULE MATERIAL			
T Teflon		Leave Blank for SS			
	T	Teflon			

8. WIRE TYPE				
CODE				
1	PVC (105° C)			
2	TEFLON (205° C)			
6	TEFLON (260° C)			
3	FIBRE GLASS (510° C)			
4	High Temp Fiberglass (704° C)			
NOTE:- Add "O" for no jacketing.				

9.	9. CODES FOR TERMINATION				
CODE					
Z	Bare ends				
STP	Standard Plug				
MP	Miniature Plug				
HTP	High Temperature Plug				
UTP	Ultra Temperature Plug				
SCP	Standard Ceramic Plug				

10. CODES FOR TERMINATION (JACK)	
CODE	
0	Not required
STJ	Standard Jack
MJ	Miniature Jack
HTJ	High Temperature Jack
UTJ	Ultra Temperature Jack
SCJ	Standard Ceramic Jack

11. OPTIONAL ACCESSORY	
CODE	
0	Not required
02	Strain relief spring (Only for lead wire without Armour)

12. OPTIONAL ACCESSORY		
CODE		
0	Not required	
WC	Wire clamp	
ВТ	Silicon rubber boot for	
	connector	
Only choose when ordering with		
connector		